

Date: 10.11.2015  
Type: RF Alert  
Document ID: CDI-01-2015



# CORRECT DEVICE INSTALLATION

Product: **TwistPort™ Adaptor for ePMP™**

Device: **ePMP™ 1000 5GHz Connectorized Radio with Sync**

When locking the ePMP™ 1000 5GHz Connectorized Radio with Sync device in the TwistPort Adaptor for ePMP, the ePMP Sync device can get stuck.

The problem can occur because of a sharpe edge on the front metal part of ePMP Sync device as shown on the pictures below.

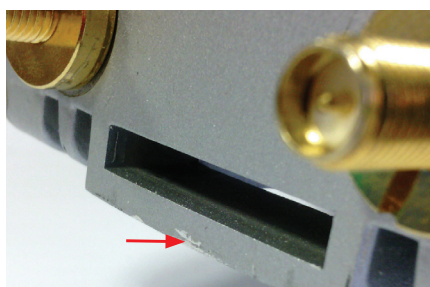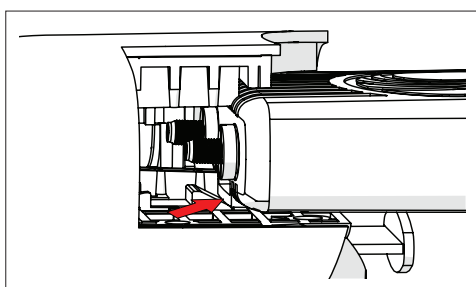

To avoid the sharp edge of the ePMP Sync device to come in contact with the slant plastic area follow these steps:

**Step1** Press the "LOCK" on the TPA for ePMP while inserting the ePMP Sync device into the TPA for ePMP.

**Step2** Release the "LOCK" and ensure the ePMP Sync device is properly secured in the TPA for ePMP.

